



---

# SERVICE BULLETIN

---

Classification:

EC09-025

Reference:

NTB09-129

Date:

November 17, 2009

---

## VENT CONTROL VALVE REPLACEMENT

**APPLIED VEHICLES:** All Nissan models using Vent Control Valve  
P/Ns 14935-AM60A / AM60B

### SERVICE INFORMATION

When replacing the EVAP canister vent control valve for any reason:

- Use the one listed in the **PARTS INFORMATION** section of this bulletin on Page 2.
- For vent control valve replacement procedure, refer to the appropriate section of the Electronic Service Manual (ESM) if needed.
- When installing the new valve, do not add any lube to its o-ring.
- For Frontier (D40 series) only: install the protector listed in **PARTS INFORMATION**.
  - For protector installation, see the **SERVICE PROCEDURE** section of this bulletin starting on Page 3.
- Make sure to use the “new style” valve listed in **PARTS INFORMATION**.


Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

**PARTS INFORMATION**

DESCRIPTION	P/N	QUANTITY
Valve Assy - Control (New Style)	14935-JF00A	1
Protector	17559-ZZ00A	1
Clip (Tie Straps)	24216-S5800	2

Old style vent control valve  
P/N 14935-AM60B

New style vent control valve  
P/N 14935-JF00A

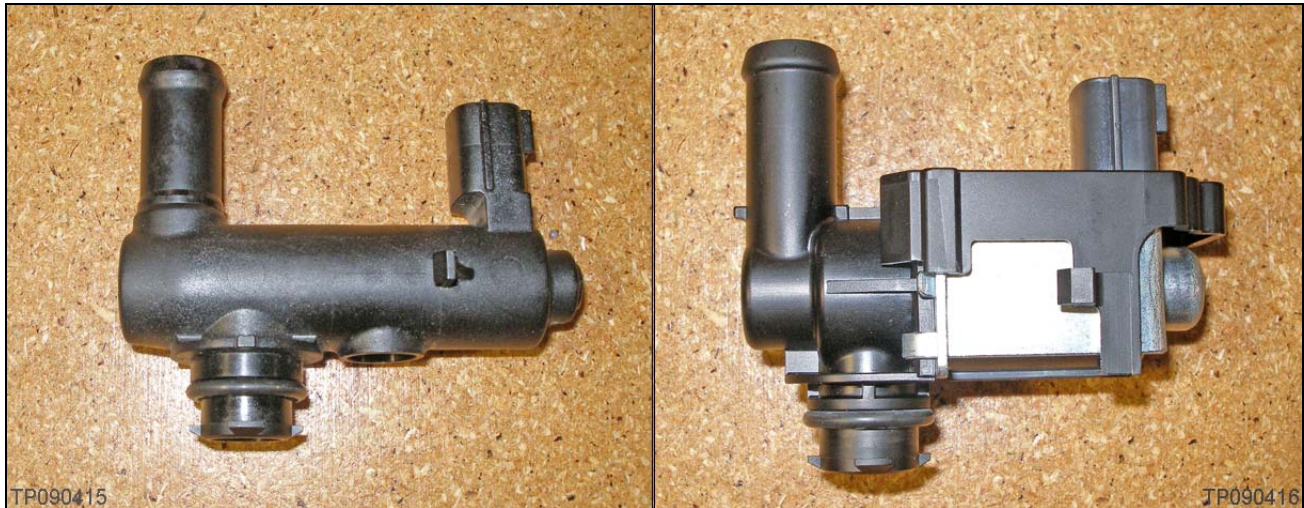

**CLAIMS INFORMATION**

Submit a Primary Failed Part (PP) line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Rpl Evap Canister Vent Control Valve	(1)	FC50AA	ZE	32	(2)

(1) Reference the Parts Information table above and use the Valve Assy - Vent Control P/N as the PFP (Primary Failed Part).


(2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated FRT (Flat Rate Time).

Also on the same repair line Frontier (D40 Series):

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Install Protector	(1)	EX25AA	ZE	32	0.2

## SERVICE PROCEDURE

### Frontier (D40 series) only: Install Protector

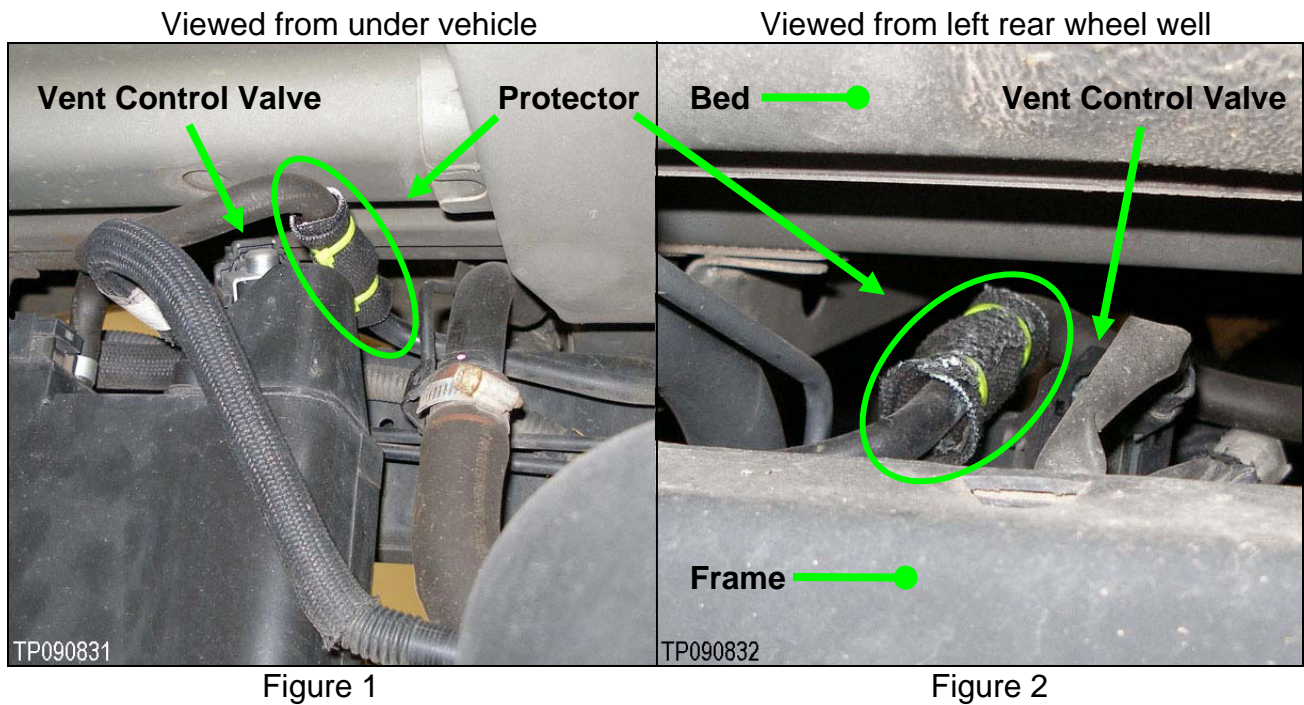

1. Wrap the protector around the EVAP hose (see Figure 1 and 2).
  - Locate the protector between the hose and the vent control valve.
2. Secure the protector with two tie straps.

